

Technical News of EFP Related Products

Subject	M38234G, M38235G Protection Address Error			
Product	EFP-S2V, EFP-S2, Serial I/O mode	Number	A08F06-01	
Object Lot	Please refer Note1	Date	June.27,2008	Rev. 1 st Rev.

< Note >

In the case of use with serial I/O mode M38234G, M38235G with 8BitQzROM microcomputer, it cannot protect even if it carry out read protection function.

* It does not have any problem in the case of the use in M38238G, M38239G, M3823AG.

< Cause >

In control software WinEFP2 of EFP-S2/EFP-S2V,
it was the mistake of the table file of serial unit (EF1SRP-01US2, EF1SRP-05U).
Protection address "A000" became "C00" by mistake. Therefore read protection was not taken..

< Influence >

① Read protection function does not become effective.

Note1:Object software

- the user who has Product CD Ver2.00 which is updated in 2008/6/18
- the user downloaded from our website.

※ The table file version number is displayed in [Help] → [About] in the WinEFP2 window menu.

< Countermeasure >

It can download Product CD Ver 2.10 in the following Web site.

Please upgrade the software.

Versions which cause problems in writing of protect bit are shown below:

- WinEfpRE : Version of Ver.1.03.99b or below
- WinEFP2 : Version of Ver.1.20.14 or below

Upgrade software can be downloaded on the website below. Please upgrade Writer control software you are using.

Website for EFP-S2/S2V: http://www.suisei.co.jp/download_e/productdata_s2_e.html

*Please click "Product CD Latest Version" on each website above.

Suisei Electronics System Co., Ltd.